



Harkness Screens UK
Tel +44 (0) 1438 725200
Fax +44 (0) 1438 344400

E-Mail sales@harkness-screens.com
www.harkness-screens.com

Harkness Screens USA
Tel +1 (540) 370 1590
Fax +1 (540) 370 1592

**TRANSLITE™ SUPER 2
FRONT/REAR PROJECTION SCREEN
DATA SHEET**

Document Ref DS-067 Issue 3 Aug 2008



Translite™ Super 2 is a flexible projection surface designed for mixed front and rear projection. It has built-in diffusion to overcome hot spotting and gives a wide viewing angle under both front and rear projection conditions. Harkness seaming techniques ensure that screens can be made up without visible seams under normal projection conditions and viewing distances. Translite™ Super 2 has excellent colour rendition and contrast.

Application

Translite™ Super 2 should be used in dark conditions; suitable for cycloramas. The most popular surface for combined front and rear projection.

Projection

Viewing side is the mat side of the surface.

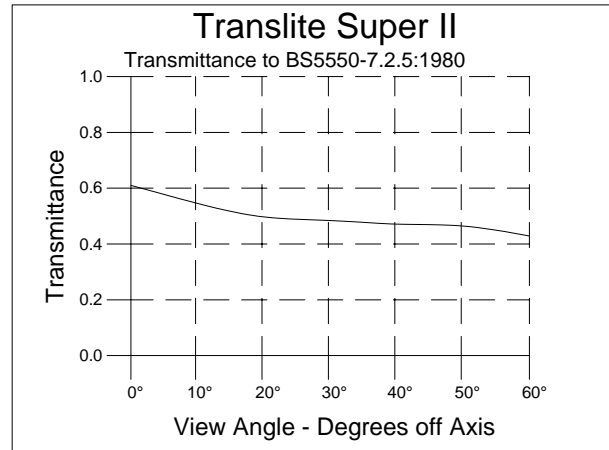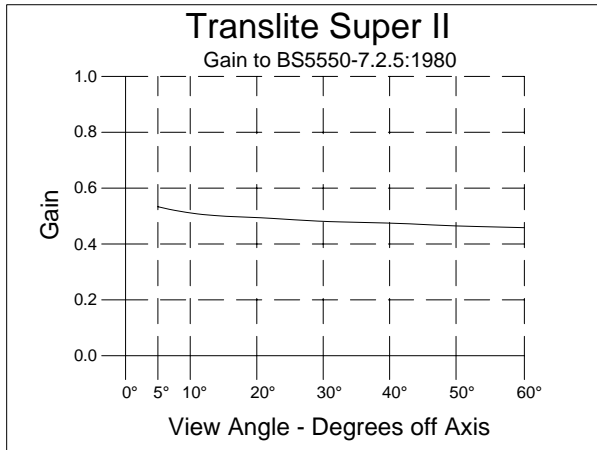

Sizes and Shapes

- Screens of any size or shape can be made up.
- Translite™ Super 2 is also available off roll (roll width 2.4m/94")

General Detail

Weight 0.43kg/m² (0.09lb/ft²)

Fire Retardancy

Certification to international standards including:
• UK BS 5867 Part 2 • France M1 • Spain M1 • USA California Fire Marshall

Typical Packing

Translite™ Super 2 screens can be folded and will be supplied as a parcel in sizes up to 90m² (1000ft²)
A wooden crate will be used for larger sizes. Surfaces for roller screens will be packed in a tube.

Despatch/Storage

Screens can be stored folded for up to one month; longer than this is not recommended.
Screens can be stored for longer periods if tube packed (unfolded).
Screens should normally be transported and stored at temperatures between 40/85°F (5/30°C) with relative humidity less than 80%.
If screens are very cold (e.g. following air transport) then they must be allowed to warm up before unpacking and installation, otherwise cold cracking may occur.

Installation

The following principles should be followed when installing Harkness Translite™ Super 2 screens:

- The environment should be clean with no building works taking place.
 - Installation should be at ambient temperature 68/75°F (20/24°C).
 - Care should be taken to avoid the screen coming into contact with sharp objects during installation.
 - Excessive loads should not be placed on any specific point of the screen.
 - Use of cotton gloves is recommended.
 - The viewing surface should not be touched.
 - Creasing should be minimised during installation.
- The securing of the screen will depend on the edge treatment specified:
- Screens with web and eyes (grommets) can be secured using sisal or screen ties (bungees)
 - Unfinished screens can be secured using Harkness 'Hold-On' clips and ties.

Care and Maintenance

The general environment where the screen is installed should be kept reasonably clean to avoid dirt and dust build-up. Screens can be periodically cleaned using a soft brush or cloth, doing this vertically with limited pressure. Under no circumstances should the screens be made wet or cleaned with any material containing bleach or other chemicals.

Edge Treatment

The following edge finishes are available as standard:

- Web and eye (grommet) with 15cm (6") spacing
- Preformed pipe pocket
- Cloth web and snap fixings for press stud (snap) frames
- Cut square (unfinished edges)